

FIG. 2

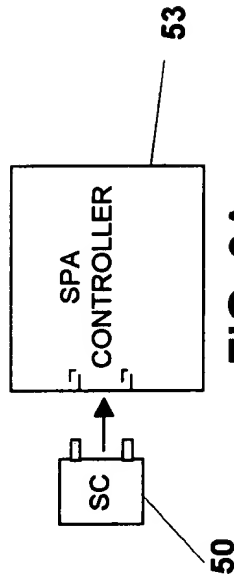


FIG. 3A

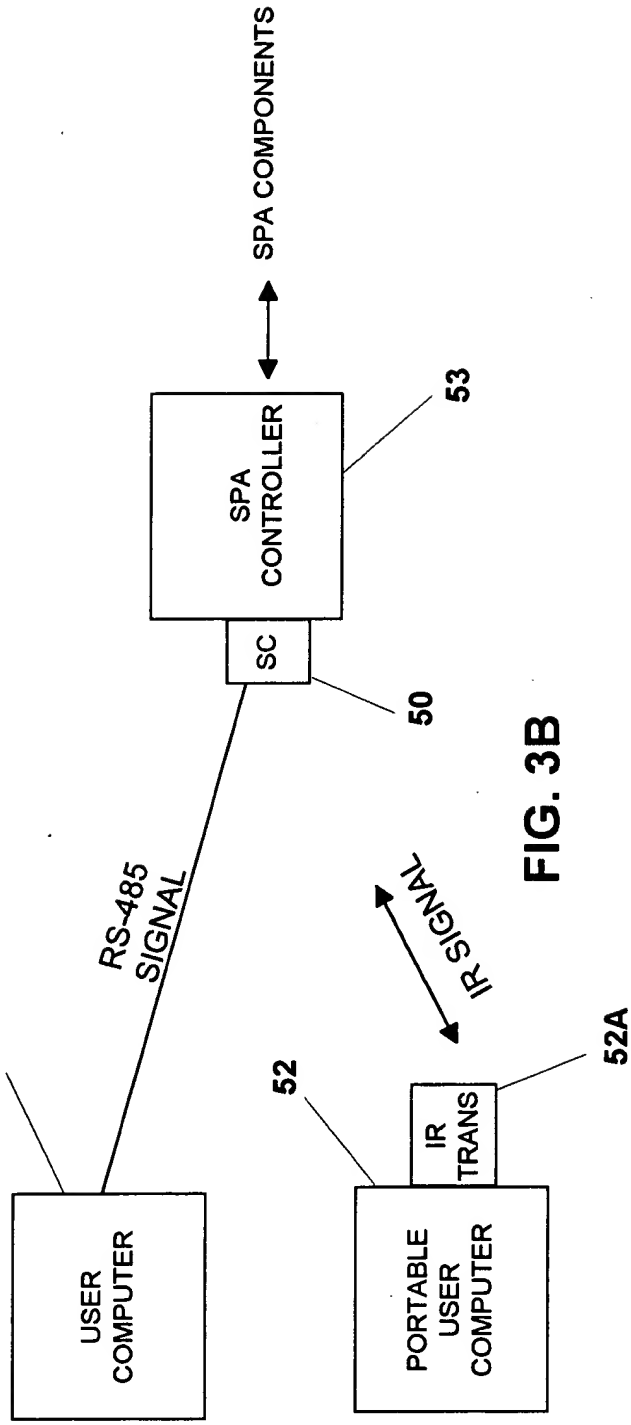


FIG. 3B

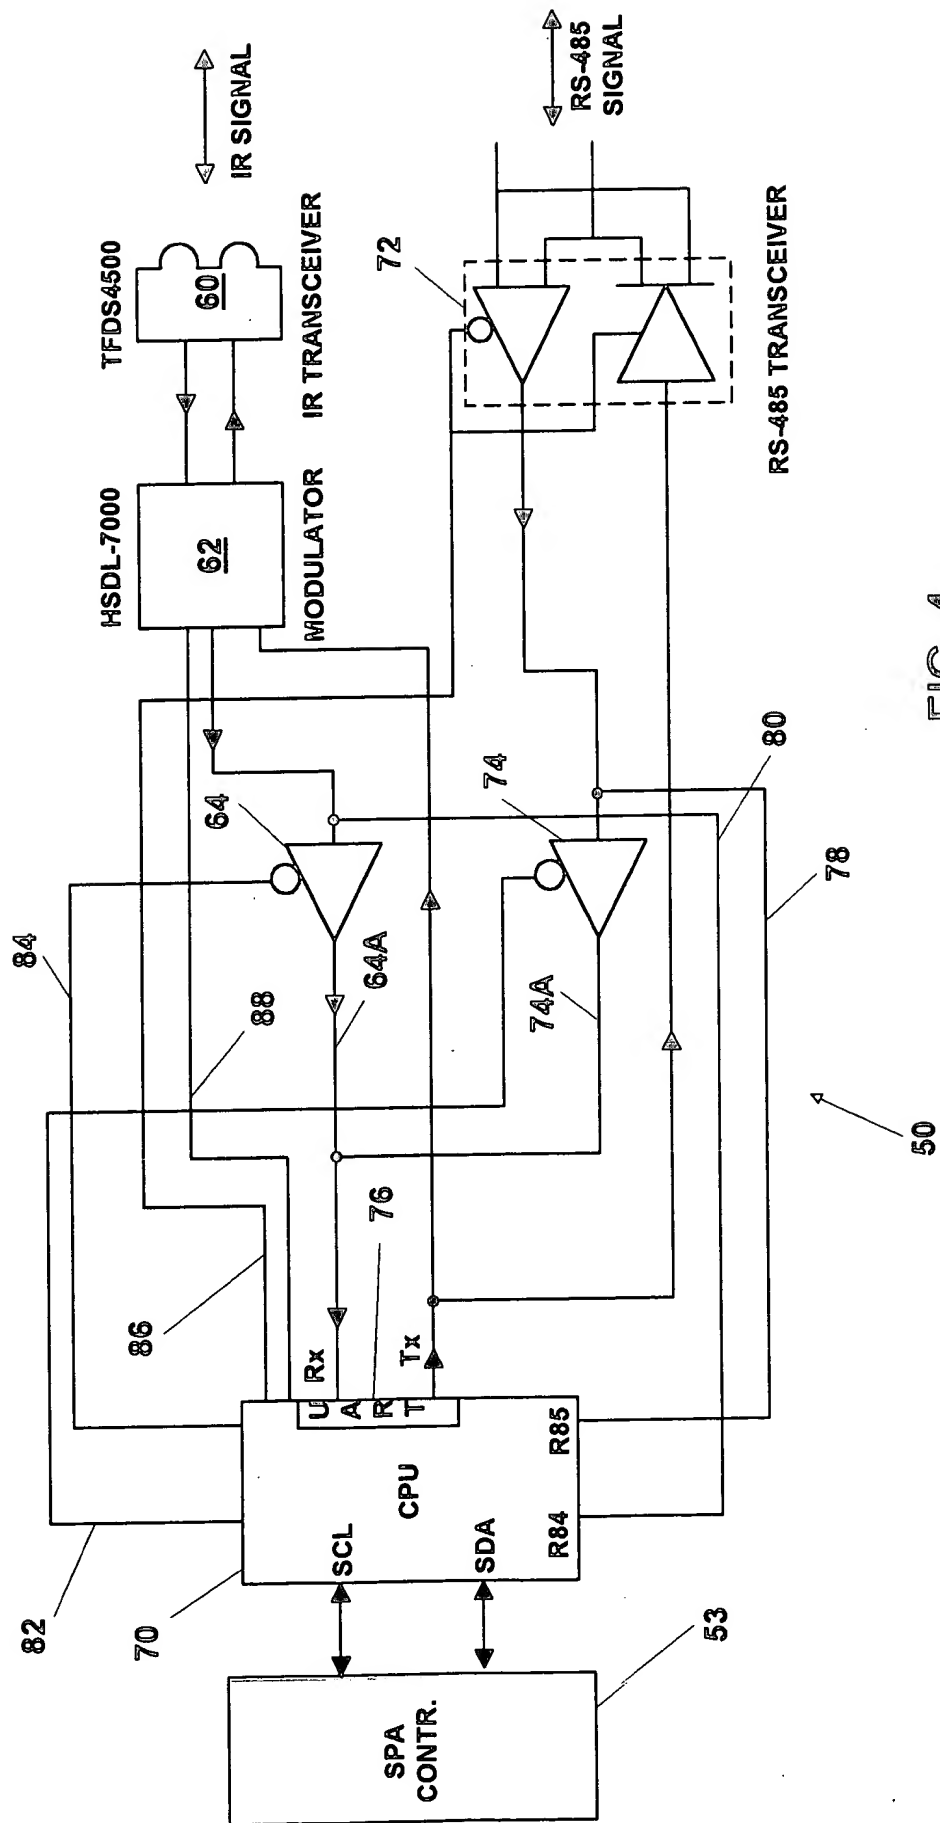


FIG. 4

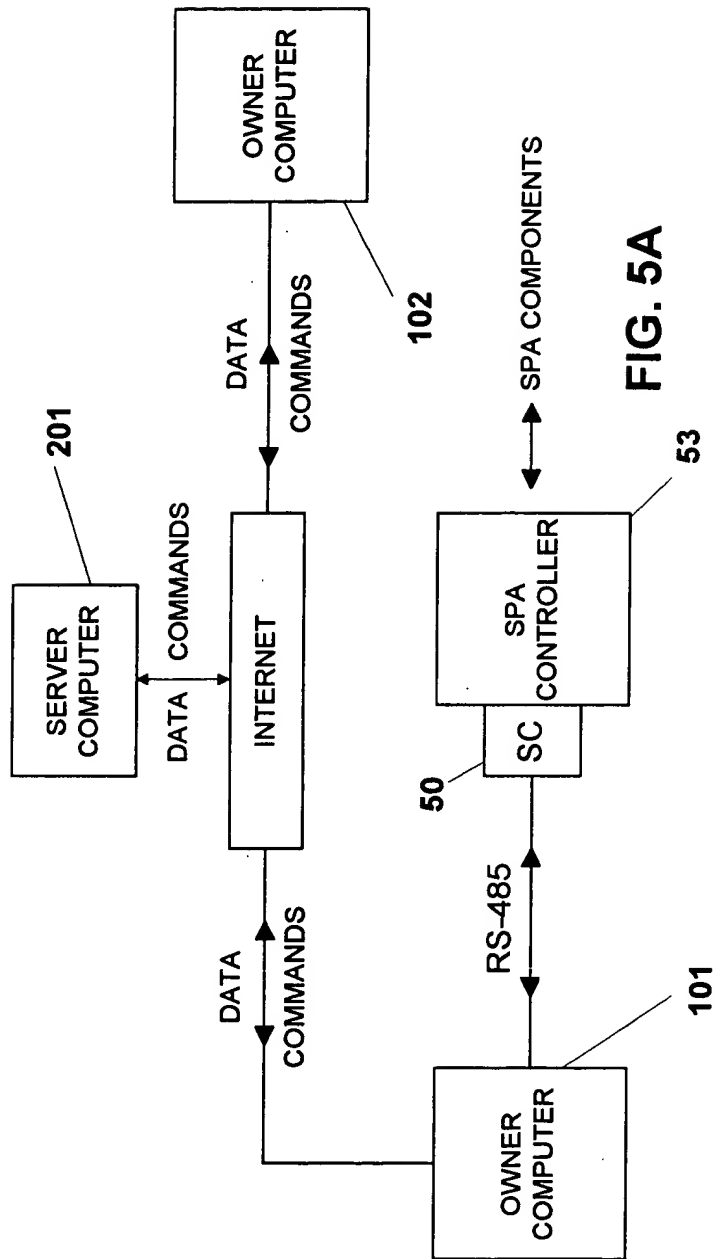


FIG. 5A

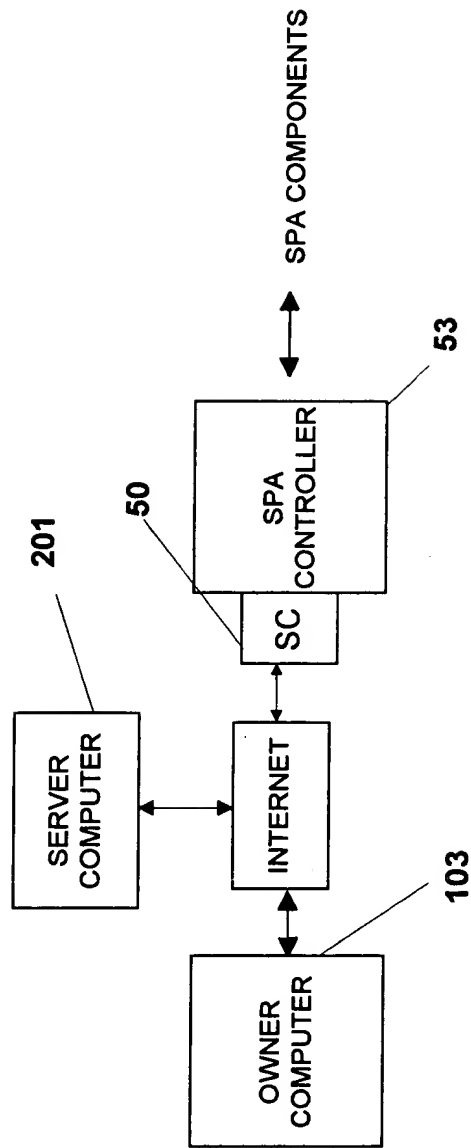


FIG. 5B

00/01/2020 13:04:50

WATER PUMP 1P: ON, HIGH SPEED ↓

WATER PUMP 2P: OFF ↓

WATER PUMP 3P: NOT INSTALLED ↓

AIR BLOWER: ON, MEDIUM SPEED ↓

CIRCULATION PUMP: NOT INSTALLED ↓

OZONATOR: OFF

LIGHT 1L: ON, LOW INTENSITY ↓

LIGHT 2L: NOT INSTALLED ↓

AUXILIARY 1A: OFF ↓

OWNER PAGE

CURRENT TIME: 01:38 PM

SET POINT: 102 °F


WATER TEMP: 98 °C

HEATER OFF


ERROR ON DISPLAY: PRESSURE SWITCH OPEN

PLUMBING FREEZE: LOW DANGER

PUMP, BLOWER TIMEOUT:

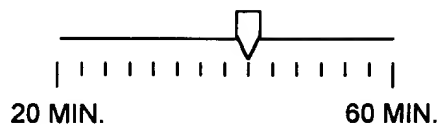


LIGHT TIMEOUT

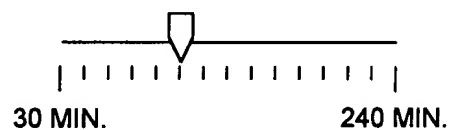

UPDATE INFO

QUIT

FIG. 6

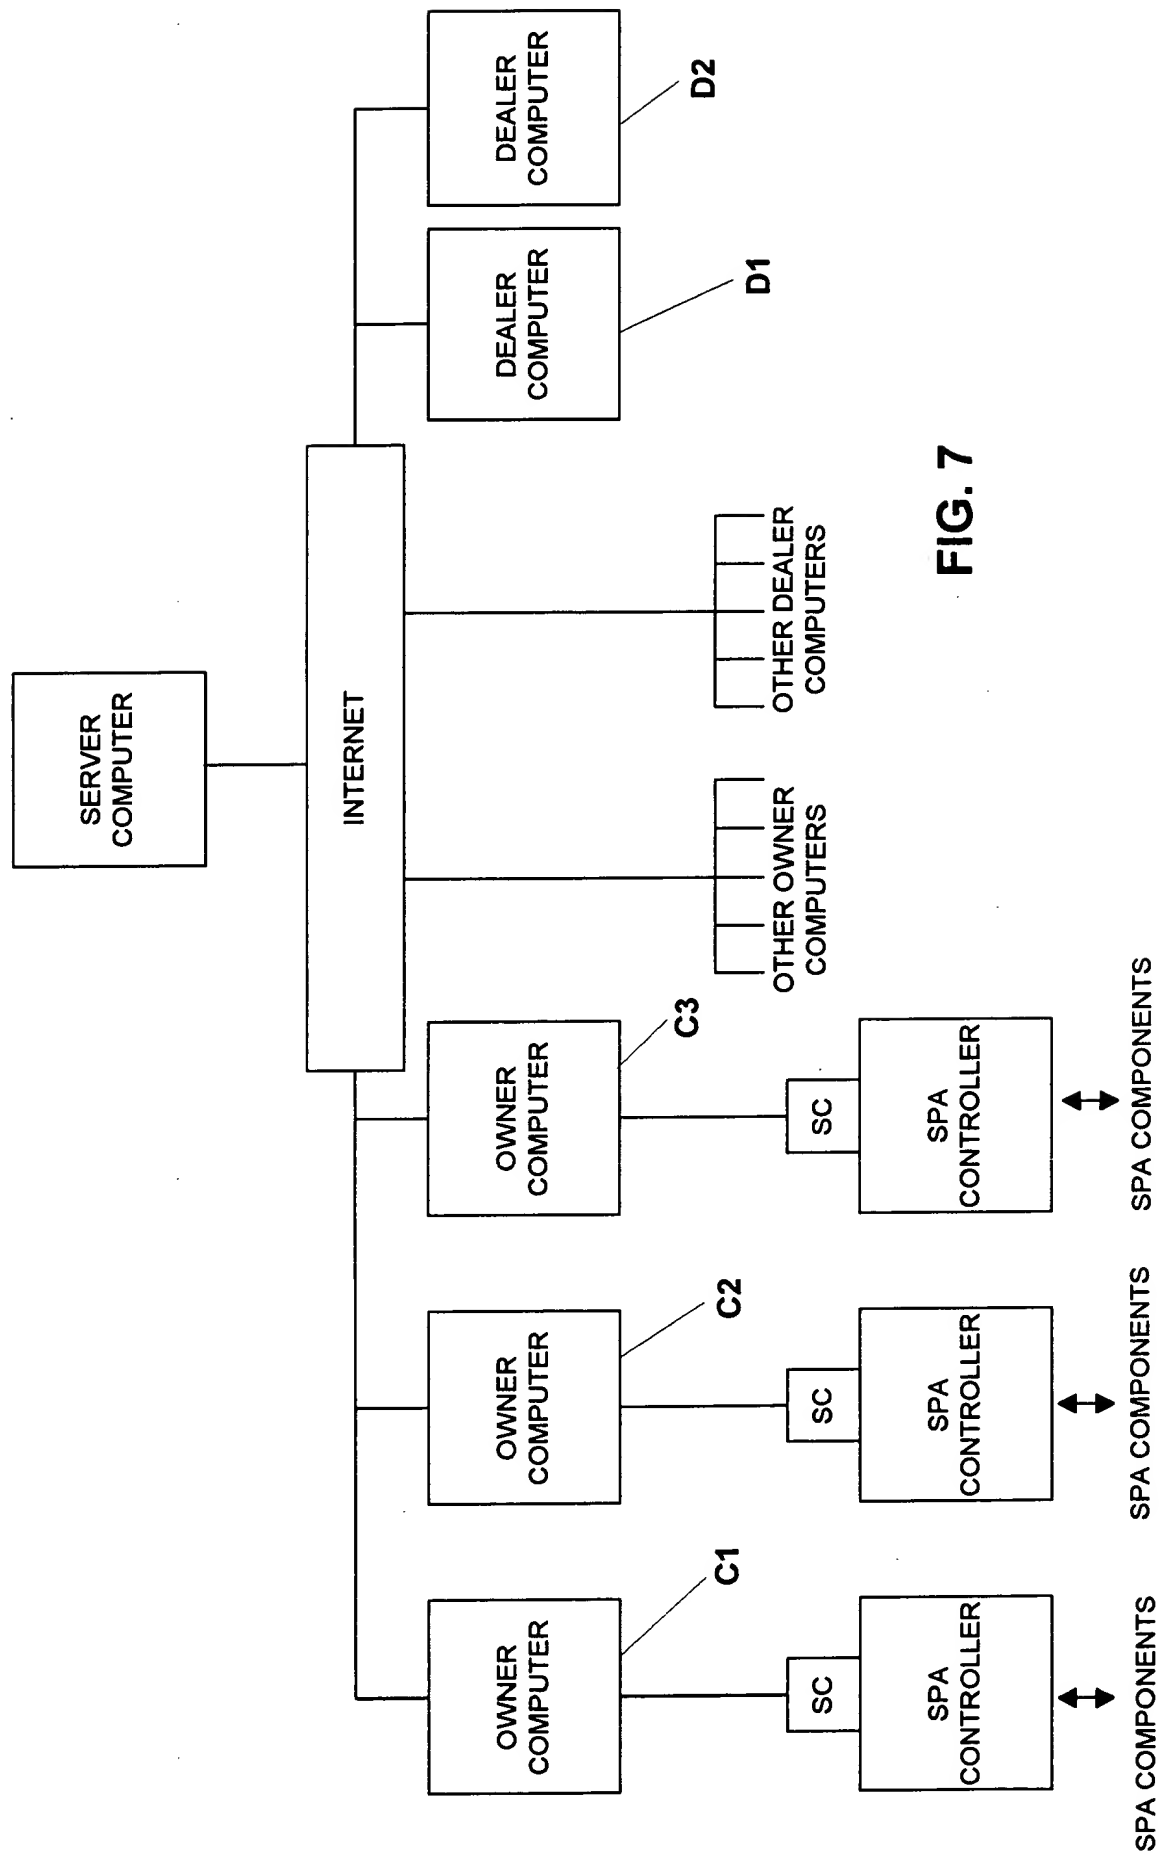

DEALER PAGE

SOFTWARE:

8936-100148, REV.B

SEND NEW SOFTWARE TO
SPA...

152

153

TROUBLE SHOOTING
SECTION:

NUMBER OF TIMES SPA
RESET:

150

154

RESET ERROR LOG

156

ERROR LOG:

ERROR	TIME	DAYS SINCE	
HIGH LIMIT	04:32 AM	3	↑
FLOW OPEN	01:48 PM	5	
			↓

NUMBER OF TIMES ERRORS OCCURED:

HIGH LIMIT:

1

FREEZE:

0

PRESSURE SWITCH STUCK OPEN:

2

PRESSURE SWITCH STUCK CLOSED:

0

TEMPERATURE PROBE PROBLEM:

3

OVERHEAT:

0

FIG. 8

SPA HOURS OF OPERATION
SINCE LAST SERVICE:

279 HOURS

155

UPDATE INFO

QUIT

00407" 48260250

SPA
MANUFACTURER
PAGE

WATER PUMP 1P:	2-SPEED	↓	LOW SPEED:	6	AMPS	HIGH SPEED:	11	AMPS
WATER PUMP 2P:	1-SPEED	↓	LOW SPEED:	6	AMPS	HIGH SPEED:	11	AMPS
WATER PUMP 3P:	NOT INSTALLED	↓		0	AMPS			
AIR BLOWER:	3-SPEED	↓		6	AMPS			

HEATER ELEMENT: 23 AMPS
MAX DRAW IN LC: 30 AMPS
MAX DRAW IN HC: 50 AMPS

QUIT

FIG. 11

002077" 28260260

SPA CONTROLLER
MANUFACTURER
PAGE

MIN. SET POINT: 59 F

MAX. SET POINT: 104 F

REGULATION OVERTEMP THRESHOLD: 112 F

	KEYPAD:	IR REMOTE:
KEY #1:	W. PUMP 1P ↓	W. PUMP 1P ↓
KEY #2:	W. PUMP 2P ↓	W. PUMP 2P ↓
KEY #3:	AIR BLOWER ↓	AIR BLOWER ↓
KEY #4:	LIGHT ↓	LIGHT ↓
KEY #5:	FILTER ↓	UNUSED ↓

FIG. 12

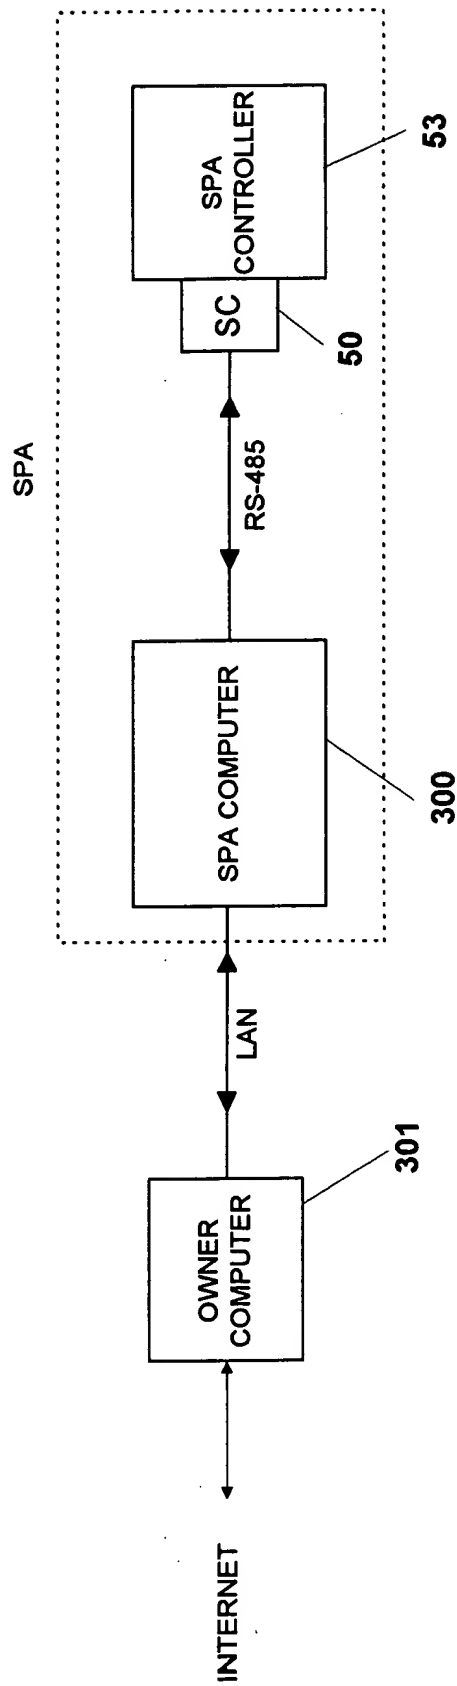


FIG. 13

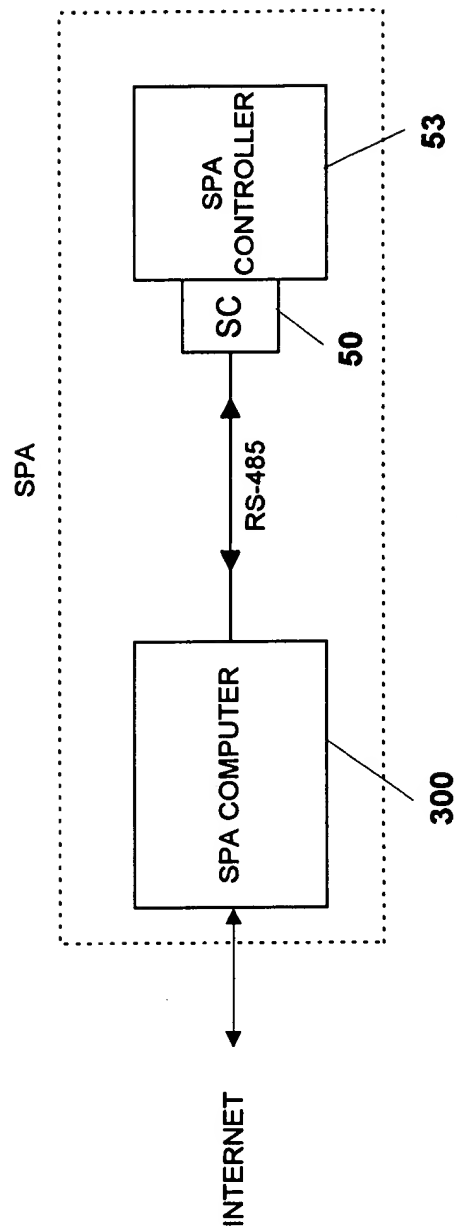


FIG. 14